




AB-1R12-402

Details

Description: Genuine Goodyear Air Springs - Rolling Lobe w/ Steel Piston

Alternate SKU: 1R12-402, 566243097, 50898-002L, 452-9297L, 452-9297, 352-117, 352-9297, AB1DK23M-9297, 566.CT66978, 566.ER9297, 050898-002, 050898-2, 50898-002, 50898-2, 050898-001, 050898-1, 50898-001, 50898-1, 9297, 064651-002, 64651-002, 064651-2, 64651-2, H50898002, H50898001, 1DK23M-9297X, 1DK23P9297, W01-358-9297, 9297, AS99110, AS9297, 50898-002, 50898-001, 50898-2, 50898-1, H-50898-002, H-50898-001, 050898-002, 050898-001, 9 10-18.5 P 935 (BK), 9 10-18.5 P 935, 66978, AS-8451, AS-8520, AS-8935

Weight (lb): 23

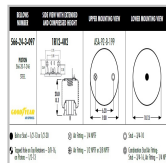

Specifications

Attribute	Value
Make	Ford, Hendrickson
Notes	Equivalent to Hendrickson H-50898-002
Top Plate Bolt Hole Quantity	2
Bottom Plate Bolt Hole Quantity	1
Top Plate Diameter	9.0 in
Bottom Plate Diameter	10.13 in
Piston Material	Steel
Minimum Height	8.1 in
Maximum Height	20.0 in
Top Plate Center To Center Diameter	6.2 in
Bottom Plate Center To Center Diameter	0 in

Bottom Plate Alignment	Parallel
Bracket	Yes
Bumper	No
Bellows Number	566-24-1-012, 566-24-3-097
Bellows Color	Black
Bellows Material	Textile Reinforced Polymer Rubber
Air Spring Type	Rolling Lube

Cross Reference

Company	SKU
Hendrickson	050898-002
Dayton	452-9297L, 452-9297
Automann	566.CT66978, AB1DK23M-9297, 566.ER9297
Goodyear	1R12-402
Firestone	W01-358-9297
Continental	66978
Goodyear Bellows	566-24-1-012, 566-24-3-097
Firestone Bellows	1T15M8
Continental Bellows	9 10-18.5
Automann Bellows	1DK23M